

Field Remedy: 1619

Subject:	Signum Instrument - Fuel Gauge Indication
-----------------	--

Models:	Engines:	Option:
Signum 2003...	All	None

Complaint:	Fuel gauge indication falls down too fast from full position.
Cause:	Fuel gauge wrongly programmed with Vectra C data. Gauge indication falls down too fast from full position and warning light comes up at 50 km remaining distance, correct is 70 km.
Production:	Separate programming procedure for Signum implemented with breakpoint VIN W0L0ZCF4831139378.

Remedy:

In case of customer complaint the instrument has to be reprogrammed with actual TIS 2000 CD # 42 data.

Labour Times:	TC:	Hours:
U3 161 90 Reprogramm instrument	92	0.3

The costs for this repair will be covered for vehicles not older than 3 years and a mileage lower than 100.000 Km.
The regular warranty procedure should be used for claiming Set-up-time.

FunctionalGroup:	N - Electrical Equipment
Complaint Group:	23 - Wrong Indication
Trouble Code:	None