Field Remedy: 1640

Subject: Instrument - ECOService-Flex oil service interval telltale illuminates (much) earlier than specified.

Models:		Engines:	Option:
Vectra-C 2003,5	5,Signum 2003,5	All,All	None
Complaint:	ECO service flex of specified.	oil service inter	val telltale illuminates (much) earlier than
Cause:	Software deviation in the instrument MY 2003,5.		
Production:		mere Port (Ve	nent available with start of MY04. ctra C) 3 8 131726 and Rüsselsheim 5.

Remedy:

In case of early warning of the ECOService-Flex indication check with TECH2 if the vehicle is equipped with a flashable CIM according to the following procedure:

Vectra-C/Signum Vehicle Service Interval Check Service Interval

Then the relevant TSB will be shown which has to be carried out to fix the vehicle:

1640: Carry out a SPS reprogramming of the CIM with the actual TIS 2000 CD # 46 data (software version 12.600)because the TECH2 has recognized that the vehicle is equipped with a flashable CIM.

1641: See TSB 1641

Remark: If the SPS reprogramming procedure is finished the service interval reset procedure have to be carried out via Tech 2 and all vehicle related trouble codes have to be deleted.

Labour Times:		TC:	Hours:	
112 164 00	Dama and Ath	0.0	0 5	
U3 164 00	Reprogram CIM	92	0.5	

The costs for this repair will be covered for vehicles not older than 3 years and a mileage lower than 100.000 Km. The regular warranty procedure should be used

for claiming Set-up-time.

FunctionalGroup:	N - Electrical Equipment
------------------	--------------------------

- Complaint Group: 04 Electrical failures
- Trouble Code: None

Field Remedy: 1641

Subject:	Instrument - ECOService-Flex oil service interval telltale illuminates (much)
	earlier than specified.

Models:		Engines:	Option:
Vectra-C 2003,5	5,Signum 2003,5	All,All	None
Complaint:	ECOService Flex oil service interval telltale illuminates (much) earlier than specified.		
Cause:	Software deviation in the instrument MY 2003,5.		
Production:		kpoints: Ellesn	nent available with start of MY04. nere Port (Vectra C) 3 8 131726 and)3 1 157315.

Remedy:

This Technical Service Bulletin refers to all MY 2003,5 vehicles which could not be fixed by TSB 1640. In case of customer complaint the instrument has to be replaced by a MY04 instrument which is used in vehicles after breakpoint Ellesmere Port (Vectra C) ... 3 8 131726 and Rüsselsheim (Vectra C, Signum) ...3 1 157315 or the instrument has to be programmed to ECOService (fix).

Remark: If the repairing procedure is finished the service interval reset procedure has to be carried out via Tech 2 and all vehicle related trouble codes have to be deleted.

Labour Times	:	TC:	Hours:
U3 164 10	Replace and reprogramm instrument	92	0.8

The costs for this repair will be covered for vehicles not older than 3 years and a mileage lower than 100.000 Km. The regular warranty procedure should be used for claiming Set-up-time.

FunctionalGroup: N - Electrical Equipment

Complaint Group: 04 - Electrical failures

Trouble Code: None